



# Studebaker

AUTOMOTIVE SALES CORPORATION

SOUTH BEND 27, INDIANA

# Service Letter

PARTS AND SERVICE

**SUBJECT** LIGHT SWITCH CIRCUIT BREAKER  
1963 LARK AND CRUISER MODELS

**FROM** C. R. McIntosh, Manager  
Passenger Car Technical Service

**NUMBER** J-1963-13

**DATE** April 26, 1963

A few field reports have indicated a condition of 'Blinking Headlights'. An investigation of this condition indicates that a few 15 Amp. Main Light Circuit Breakers were used rather than the released 20 Amp. Circuit Breakers. The two circuit breakers are the same size and shape. The amperage of each unit is marked on the bakelite portion of the units.

If you encounter a condition of 'Blinking Headlights' on 1963 Lark or Cruiser models, remove the circuit breaker located in a clip-type holder to the left of the ignition switch. Check the indicated amperage and replace the unit if it is identified as anything other than a 20 amp. unit.

The correct part number for the 20 Amp. Circuit Breaker is 1688932.

CRM/et